

# NHTSA Recall 4404/50

Affecting the headlight system on early car's

<p><b>Alfa Romeo, Inc. Headquarters</b>          250 Sylvan Ave., Englewood Cliffs, N. J. 07439          (201) 871-1224</p>		<p>Group 40 File 1          Campaign 4404/50          Subject HEADLIGHT WIRING          MODIFICATION          Date MAY 12, 1988</p>
---	---	---

**RECALL CAMPAIGN NO. 4404/50  
 1987-88 ALFA ROMEO MILANOS  
HEADLIGHT WIRING MODIFICATION**

**VEHICLES:** All 1987 and some early 1988 models.\*

**CONDITION:** Possible loss of headlamp illumination due to deterioration of electrical contact at the power feed terminal of the headlamp switch and subsequent deformation of switch body.

**REMEDY:**

- A. Replacing the terminal connector of the power feed wire to the headlamp switch with a superior design, phosphorus-bronze plated, female spade connector.
- B. Thorough inspection of the headlamp switch in the power feed terminal area to detect any deformation of the switch body, replace switch if necessary.
- C. Installing a relay to carry power to the low beam headlamps to reduce the load on the headlamp switch power feed terminal.

**PARTS:**

- A. Headlamp modification kit Part No. 8500 60897350 containing:
 

<u>DESCRIPTION</u>	<u>QUANTITY</u>
Headlamp modification wiring harness	1
Headlamp relay	1
Phosphorus-bronze plated connectors	2
Protective insulating sleeve	1
Recall sticker	1
- B. Open-barrel crimping tool, one sent to each dealer. Replacements available under Part No. 8501.

\*Owners of vehicles within category of affected vehicles will be sent the attached owner notification and dealer modification voucher. Master list on file at ARI.

**COST: A. Headlamp Modification Kit, Part No. 8500.**

1. An initial supply of headlight modification kits will be shipped to your dealership. Your Parts Account will be charged accordingly for each kit.  
Dealer Net: \$10.52  
Sugg. Retail: \$12.37

2. Additional kits must be ordered through your Parts Department.

**B. Open-barrel crimping tool Part No. 8501.**

1. One tool will be supplied separately free-of-charge. (Enclosed with Service Manager's copy of this bulletin)
2. Additional tools may be ordered through your Parts Department or may purchased through Radio Shack under P/N 64-410.


INSPECT/MODIFY

OPERATION CODE:	4188900
DEFECT CODE:	440403305
CLASS CODE:	50
LABOR HRS.:	0.75 hrs.

**WARRANTY REIMBURSEMENT:** On receipt of the correctly completed recall claim form. (See sample recall claim form attached)

INSPECTION DETAILS

VEHICLES WHICH DO NOT NEED HEADLAMP MODIFICATION

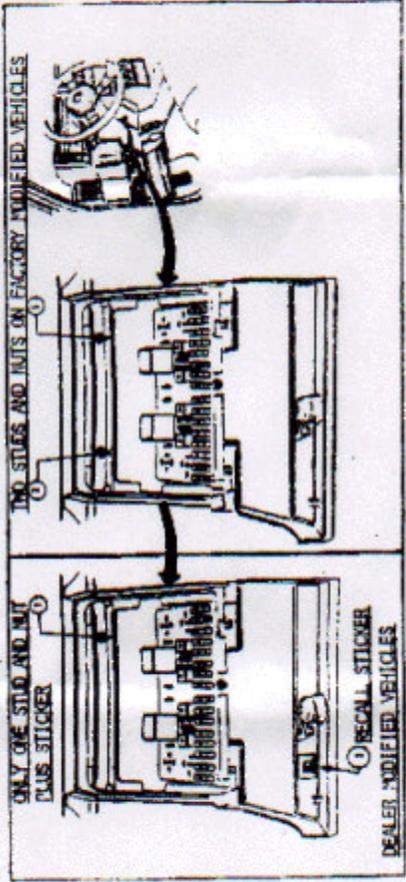


- 1 -

VEHICLES WHICH MUST HAVE RECALL PERFORMED

ONLY ONE STUD AND NUT

AND

NO RECALL STICKERS

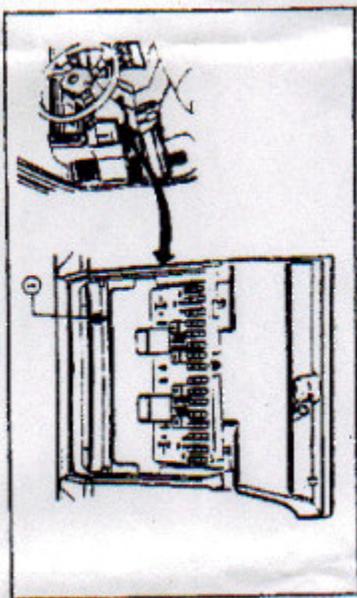

[Page 2](#)

[Home](#)